


Wrapid Tape™

HCA, HCO, HCC


Primer-less, Crosslinked, Corrosion Protection Tape.

Product Description

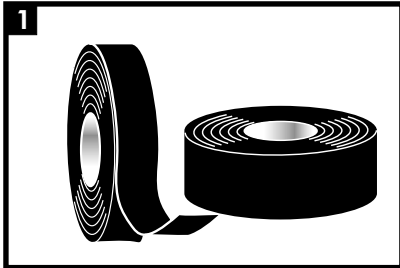


Canusa Wrapid Tape™ is supplied in 15 m length bulk rolls, in several widths to suit the project diameter.

Storage & Safety Guidelines

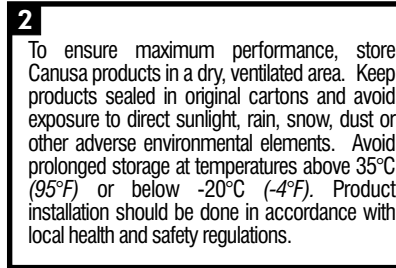


To ensure maximum performance, store Canusa products in a dry, ventilated area. Keep products sealed in original cartons and avoid exposure to direct sunlight, rain, snow, dust or other adverse environmental elements. Avoid prolonged storage at temperatures above 35°C (95°F) or below -20°C (-4°F). Product installation should be done in accordance with local health and safety regulations.

Equipment List

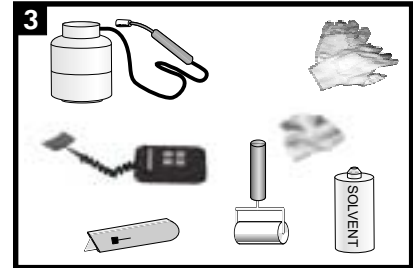


Propane tank, hose, torch & regulator
Appropriate tools for surface abrasion
Knife, roller, rags & approved solvent cleanser
Digital thermometer with suitable probe
Standard safety equipment; gloves, goggles, hard hat, etc.


Flame Intensity & Torch Size

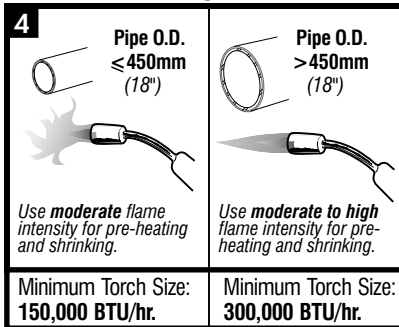


Surface Preparation

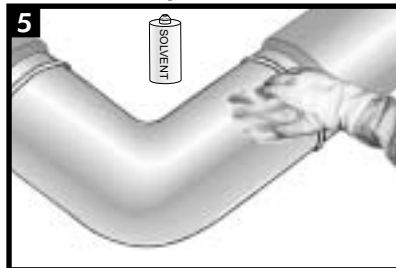

Ensure that the PE coating edges are beveled to 30°. Clean exposed steel and adjacent pipe coating with a solvent cleanser to remove the presence of oil, grease, and other contaminants.

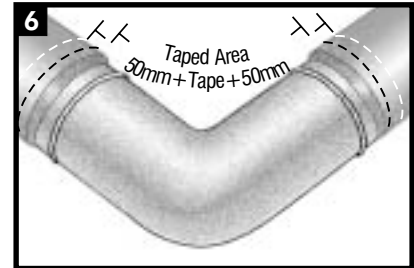


Ensure that the pipe is dry before cleaning. Prepare the steel joint area to a minimum of S₁3 / SP3. Lightly abrade the pipe coating adjacent to the weld area to a distance of 50mm (2") beyond each end of the area to be taped.

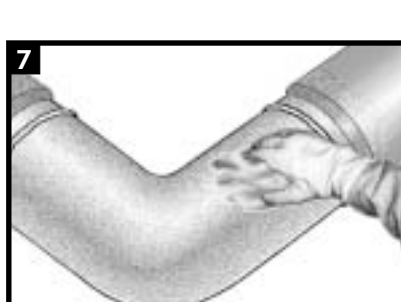


Wipe clean or air blast the steel and pipe coating to remove foreign contaminants.

Pre-Heat

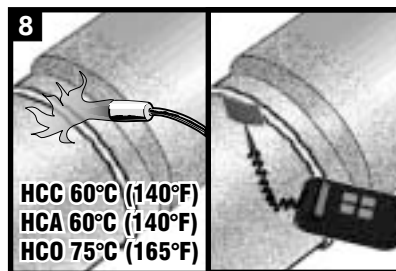


Pre-Heat the joint area to the minimum required temperature **HCA: 60°C (140°F)** **HCO: 75°C (165°F)** **HCC: 60°C (140°F)**. Using a temperature measuring device, ensure that the correct temperature is reached on the steel and at least 50mm (2") on each side of the tape.

Tape Installation

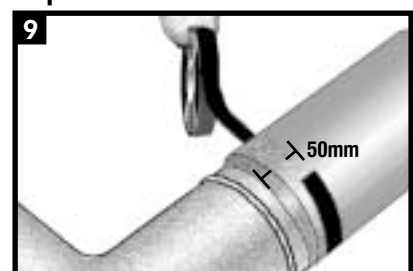


Starting at least 50mm (2") onto the pipe coating, begin wrapping the tape around the joint, ensuring a minimum 50% spiral overlap. Ensure that the powdered tape side is placed onto the pipe. Remove any plastic release liners as the product is wrapped.


Wrapid Tape™ - HCA, HCO, HCC

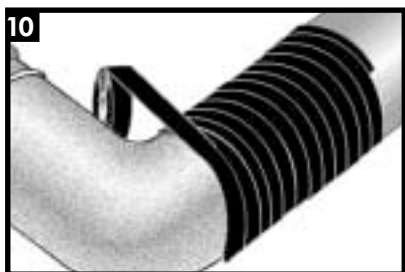

Continue wrapping the pipe ensuring a minimum 50% overlap.

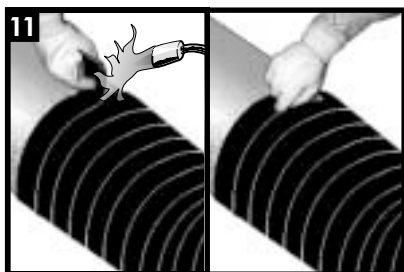


Warm the tape end and press down firmly. A hold-down tape can be used to secure the tape end.

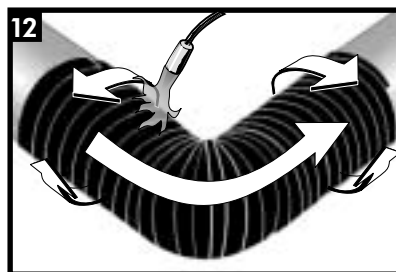

Using a torch, begin at the edge of the tape and heat circumferentially around the joint, working back to the other edge.


Inspection

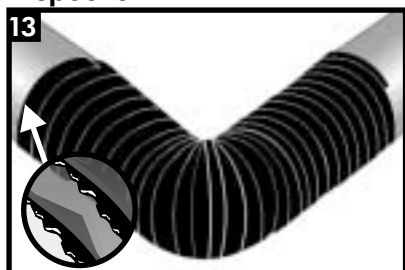

Visually inspect the taped joint for the following:

- Tape is in full contact with the joint and extends 50mm (2") onto the pipe coating.
- Adhesive flows at the tape edges.
- No cracks or holes in the tape.

Backfilling Guidelines

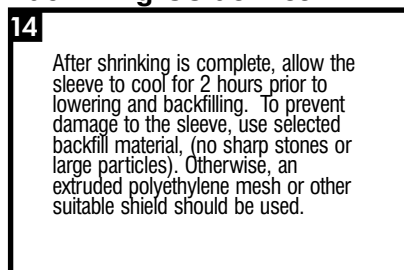

Tape Usage Guide

Nominal Pipe Diameter	Recommended Tape Width		Length of Tape Required	
			3D Bend	5D Bend
	DN inches	mm inches	m feet	m feet
25	1	50 2	2.8 9.3	2.8 9.3
40	1.5	50 2	4.0 13.2	4.6 15
50	2	50 2	5.2 17	6.2 20.3
80	3	50 2	8.5 28	10.6 34.7
100	4	50 2	12.3 40	14.8 48.6
125	5	75 3	11.1 36.4	13.6 44.6
150	6	75 3	14.3 46.9	18.3 60
200	8	100 4	16.3 53.4	20.8 68.2
250	10	100 4	23.1 75.8	30.6 100.4
300	12	100 4	30.4 99.8	40.9 134.2
>300	>12	150 6	see formula at right	

The table at left shows the typical usage for 3D and 5D bends, assuming a line coating cutback of 150 mm (6") and a 50 mm (2") overlap onto the pipe coating.

For other sizes, the following formula can be used:
Length of tape = $\pi \times \text{pipe diameter} \times L/W$
 where L=length of area to be covered, and
 $W = \frac{1}{2}$ of tape width (for 50% overlap)



A SHAWCOR COMPANY

www.canusacps.com

Canada

CANUSA-CPS
 a division of SHAWCOR LTD.
 25 Bethridge Road
 Rexdale, Ontario
 M9W 1M7,
 Canada
 Tel: +1 (416) 743-7111
 Fax: +1 (416) 743-5927

U.S.A./Latin America

CANUSA-CPS
 a division of SHAWCOR INC.
 2408 Timberloch Place
 Building C-8
 The Woodlands, Texas
 77380, U.S.A.
 Tel: +1 (281) 367-8866
 Fax: +1 (281) 367-4304

Europe/Middle East

CANUSA-CPS
 a division of Canusa Systems Ltd.
 Unit 3, Sterling Park
 Gatwick Road
 Crawley, West Sussex
 England RH10 9QT
 Tel: +44 (1293) 541254
 Fax: +44 (1293) 541777

Asia/Pacific

CANUSA-CPS
 BrederoShaw (S) Pte Ltd
 101 Thomson Road
 #17-01/02, United Square
 Singapore
 307591
 Tel +65-6732-2355
 Fax +65-6732-9073

Canusa warrants that the product conforms to its chemical and physical description and is appropriate for the use stated on the installation guide when used in compliance with Canusa's written instructions. Since many installation factors are beyond our control, the user shall determine the suitability of the products for the intended use and assume all risks and liabilities in connection therewith. Canusa's liability is stated in the standard terms and conditions of sale. Canusa makes no other warranty either expressed or implied. All information contained in this installation guide is to be used as a guide and is subject to change without notice. This installation guide supersedes all previous installation guides on this product. E&OE